

# RESERVE ANALYSIS REPORT

## **Boulder Creek Neighborhoods - Pinnacle**

Louisville, Colorado

Version 2

Monday, November 11, 2019



**ADVANCED RESERVE SOLUTIONS, INC.**

6860 S. Yosemite Court, Suite 2000

Centennial, Colorado 80112

Phone (303) 953-2078

[www.arsinc.com](http://www.arsinc.com)

© 1997 - 2019

ADVANCED RESERVE SOLUTIONS, INC.

All Rights Reserved.

# Boulder Creek Neighborhoods - Pinnacle

## Table of Contents

	<b>Page</b>
Preface	i
Executive Summary	1
Disclosure Statement	2
Calculation of Percent Funded	3
Management Summary	5
Management Charts	7
Annual Expenditure Detail	9
Projections	10
Projection Charts	11
Component Detail	13
Index	24

# Preface

This preface is intended to provide an introduction to the enclosed reserve analysis as well as detailed information regarding the reserve analysis report format, reserve fund goals/objectives and calculation methods. The following sections are included in this preface:

<b>Introduction to Reserve Budgeting</b> .....	page i
<b>Understanding the Reserve Analysis</b> .....	page i
<b>Reserve Funding Goals / Objectives</b> .....	page ii
<b>Reserve Funding Calculation Methods</b> .....	page ii
<b>Reading the Reserve Analysis</b> .....	page v
<b>Glossary of Key Terms</b> .....	page x
<b>Limitations of Reserve Analysis</b> .....	page xiii

## ◆ ◆ ◆ ◆ INTRODUCTION TO RESERVE BUDGETING ◆ ◆ ◆ ◆

The Board of Directors of an association has a legal and fiduciary duty to maintain the community in a good state of repair. Individual unit property values are significantly impacted by the level of maintenance and upkeep provided by the association as well as the amount of the regular assessment charged to each owner.

A prudent plan must be implemented to address the issues of long-range maintenance, repair and replacement of the common areas. Additionally, the plan should recognize that the value of each unit is affected by the amount of the regular assessment charged to each unit.

There is a fine line between “not enough,” “just right” and “too much.” Each member of an association should contribute to the reserve fund for their proportionate amount of “depreciation” (or “use”) of the reserve components. Through time, if each owner contributes his “fair share” into the reserve fund for the depreciation of the reserve components, then the possibility of large increases in regular assessments or special assessments will be minimized.

An accurate reserve analysis and a “healthy” reserve fund are essential to protect and maintain the association's common areas and the property values of the individual unit owners. A comprehensive reserve analysis is one of the most significant elements of any association's long-range plan and provides the critical link between sound business judgment and good fiscal planning. The reserve analysis provides a “financial blueprint” for the future of an association.

## ◆ ◆ ◆ ◆ UNDERSTANDING THE RESERVE ANALYSIS ◆ ◆ ◆ ◆

In order for the reserve analysis to be useful, it must be understandable by a variety of individuals. Board members (from seasoned, experienced Board members to new Board members), property managers, accountants, attorneys and even homeowners may ultimately review the reserve analysis. The reserve analysis must be detailed enough to provide a comprehensive analysis, yet simple enough to enable less experienced individuals to understand the results.

There are four key bits of information that a comprehensive reserve analysis should provide: Budget, Percent Funded, Projections and Inventory. This information is described as follows:

### **Budget**

Amount recommended to be transferred into the reserve account for the fiscal year for which the reserve analysis was prepared. In some cases, the reserve analysis may present two or more funding plans based on different goals/objectives. The Board should have a clear understanding of the differences among these funding goals/objectives prior to implementing one of them in the annual budget.

### **Percent Funded**

Measure of the reserve fund “health” (expressed as a percentage) as of the beginning of the fiscal year for which the

## Preface

reserve analysis was prepared. This figure is the ratio of the actual reserve fund on hand to the fully funded balance. A reserve fund that is “100% funded” means the association has accumulated the proportionately correct amount of money, to date, for the reserve components it maintains.

### **Projections**

Indicate the “level of service” the association will provide the membership as well as a “road map” for the fiscal future of the association. The projections define the timetables for repairs and replacements, such as when the buildings will be painted or when the asphalt will be seal coated. The projections also show the financial plan for the association – when an underfunded association will “catch up” or how a properly funded association will remain fiscally “healthy.”

### **Inventory**

Complete listing of the reserve components. Key bits of information are available for each reserve component, including placed-in-service date, useful life, remaining life, replacement year, quantity, current cost of replacement, future cost of replacement and analyst’s comments.

## ◆ ◆ ◆ ◆ RESERVE FUNDING GOALS / OBJECTIVES ◆ ◆ ◆ ◆

There are four reserve funding goals/objectives which may be used to develop a reserve funding plan that corresponds with the risk tolerance of the association: Full Funding, Baseline Funding, Threshold Funding and Statutory Funding. These goals/objectives are described as follows:

### **Full Funding**

Describes the goal/objective to have reserves on hand equivalent to the value of the deterioration of each reserve component. The objective of this funding goal is to achieve and/or maintain a 100% percent funded reserve fund. The component calculation method or cash flow calculation method is typically used to develop a full funding plan.

### **Baseline Funding**

Describes the goal/objective to have sufficient reserves on hand to never completely run out of money. The objective of this funding goal is to simply pay for all reserve expenses as they come due without regard to the association’s percent funded. The cash flow calculation method is typically used to develop a baseline funding plan.

### **Threshold Funding**

Describes the goal/objective other than the 100% level (full funding) or just staying cash-positive (baseline funding). This threshold goal/objective may be a specific percent funded target or a cash balance target. Threshold funding is often a value chosen between full funding and baseline funding. The cash flow calculation method is typically used to develop a threshold funding plan.

### **Statutory Funding**

Describes the pursuit of an objective as described or required by local laws or codes. The component calculation method or cash flow calculation method is typically used to develop a statutory funding plan.

## ◆ ◆ ◆ ◆ RESERVE FUNDING CALCULATION METHODS ◆ ◆ ◆ ◆

There are two funding methods which can be used to develop a reserve funding plan based on a reserve funding goal/objective: Component Calculation Method and Cash Flow Calculation Method. These calculation methods are described as follows:

### **Component Calculation Method**

This calculation method develops a funding plan for each individual reserve component. The sum of the funding plan for each component equals the total funding plan for the association. This method is often referred to as the “straight line”

## Preface

method and is widely believed to be the most conservative reserve funding method. This method structures a funding plan that enables the association to pay all reserve expenditures as they come due, enables the association to achieve the ideal level of reserves in time, and then enables the association to maintain the ideal level of reserves through time. The following is a detailed description of the component calculation method:

### Step 1: Calculation of fully funded balance for each component

The fully funded balance is calculated for each component based on its age, useful life and current cost. The actual formula is as follows:

$$\text{Fully Funded Balance} = \frac{\text{Age}}{\text{Useful Life}} \times \text{Current Cost}$$

### Step 2: Distribution of current reserve funds

The association's current reserve funds are assigned to (or distributed amongst) the reserve components based on each component's remaining life and fully funded balance as follows:

Pass 1: Components are organized in remaining life order, from least to greatest, and the current reserve funds are assigned to each component up to its fully funded balance, until reserves are exhausted.

Pass 2: If all components are assigned their fully funded balance and additional funds exist, they are assigned in a "second pass." Again, the components are organized in remaining life order, from least to greatest, and the remaining current reserve funds are assigned to each component up to its current cost, until reserves are exhausted.

Pass 3: If all components are assigned their current cost and additional funds exist, they are assigned in a "third pass." Components with a remaining life of zero years are assigned double their current cost.

Distributing, or assigning, the current reserve funds in this manner is the most efficient use of the funds on hand – it defers the make-up period of any underfunded reserves over the lives of the components with the largest remaining lives.

### Step 3: Developing a funding plan

After step 2, all components have a "starting" balance. A calculation is made to determine what funding would be required to get from the starting balance to the future cost over the number of years remaining until replacement. The funding plan incorporates the annual contribution increase parameter to develop a "stair stepped" contribution.

For example, if an association needs to accumulate \$100,000 in ten years, \$10,000 could be contributed each year. Alternatively, the association could contribute \$8,723 in the first year and increase the contribution by 3% each year thereafter until the tenth year.

In most cases, this rate should match the inflation parameter. Matching the annual contribution increase parameter to the inflation parameter indicates, in theory, that member contributions should increase at the same rate as the cost of living (inflation parameter). Due to the "time value of money," this creates the most equitable distribution of member contributions through time.

Using an annual contribution increase parameter that is greater than the inflation parameter will reduce the burden to the current membership at the expense of the future membership. Using an annual contribution increase parameter that is less than the inflation parameter will increase the burden to the current membership to the benefit of the future membership. The following chart shows a comparison:

## Preface

	<u>0% Increase</u>	<u>3% Increase</u>	<u>10% Increase</u>
Year 1	\$10,000.00	\$8,723.05	\$6,274.54
Year 2	\$10,000.00	\$8,984.74	\$6,901.99
Year 3	\$10,000.00	\$9,254.28	\$7,592.19
Year 4	\$10,000.00	\$9,531.91	\$8,351.41
Year 5	\$10,000.00	\$9,817.87	\$9,186.55
Year 6	\$10,000.00	\$10,112.41	\$10,105.21
Year 7	\$10,000.00	\$10,415.78	\$11,115.73
Year 8	\$10,000.00	\$10,728.25	\$12,227.30
Year 9	\$10,000.00	\$11,050.10	\$13,450.03
Year 10	\$10,000.00	\$11,381.60	\$14,795.04
TOTAL	<u>\$100,000.00</u>	<u>\$100,000.00</u>	<u>\$100,000.00</u>

This parameter is used to develop a funding plan only; it does not mean that the reserve contributions must be raised each year. There are far more significant factors that will contribute to a total reserve contribution increase or decrease from year to year than this parameter.

One of the major benefits of using this calculation method is that for any single component (or group of components), the accumulated balance and reserve funding can be precisely calculated. For example, using this calculation method, the reserve analysis can indicate the exact amount of current reserve funds "in the bank" for the roofs and the amount of money being funded towards the roofs each month. This information is displayed on the Management / Accounting Summary and Charts as well as elsewhere within the report.

The component calculation method is typically used for well-funded associations (greater than 65% funded) with a goal/objective of full funding.

### **Cash Flow Calculation Method**

This calculation method develops a funding plan based on current reserve funds and projected expenditures during a specific timeframe (typically 30 years). This funding method structures a funding plan that enables the association to pay for all reserve expenditures as they come due, but is not necessarily concerned with the ideal level of reserves through time.

This calculation method tests reserve contributions against reserve expenditures through time to determine the minimum contribution necessary (baseline funding) or some other defined goal/objective (full funding, threshold funding or statutory funding).

Unlike the component calculation method, this calculation method cannot precisely calculate the reserve funding for any single component (or group of components). In order to work-around this issue to provide this bookkeeping information, a formula has been applied to component method results to calculate a reasonable breakdown. This information is displayed on the Management / Accounting Summary and Charts as well as elsewhere within the report.

The cash flow calculation method is typically used for under-funded associations (less than 65% funded) with a goal/objective of full funding, threshold funding, baseline funding or statutory funding.

# Preface

## ◆ ◆ ◆ ◆ READING THE RESERVE ANALYSIS ◆ ◆ ◆ ◆

In some cases, the reserve analysis may be a lengthy document of one hundred pages or more. A complete and thorough review of the reserve analysis is always a good idea. However, if time is limited, it is suggested that a thorough review of the summary pages be made. If a “red flag” is raised in this review, the reader should then check the detail information, of the component in question, for all relevant information. In this section, a description of most of the summary or report sections is provided along with comments regarding what to look for and how to use each section.

### Executive Summary

Provides general information about the client, global parameters used in the calculation of the reserve analysis as well as the core results of the reserve analysis.

#### **Client Information**

Provides various client information including fiscal year for which the reserve analysis was prepared, number of units, phasing, etc.

#### **Global Parameters**

Displays the calculation parameters that were used to calculate the reserve analysis including inflation, annual contribution increase, investment rate, tax rate and contingency.

#### **Community Profile**

Provides brief description of the community, as well as other “global” type comments.

#### **Budget**

Provides recommended funding for the fiscal year for which the reserve analysis was prepared. Indicates the reserve funding from the membership, anticipated interest contribution and the total contribution

**Sample Homeowners Association**  
Executive Summary  
Component Calculation Method

Client Information:		Global Parameters:	
Account Number	00000	Inflation Rate	2.00%
Version Number	1	Annual Contribution Increase	2.00%
Analysis Date	3/18/2014	Investment Rate	1.00%
Fiscal Year	6/1/2014 to 5/31/2015	Taxes on Investment	30.00%
Number of Units	167	Contingency	3.00%
Phasing	8 of 8		

**Community Profile:**  
This community consists of 167 attached units with private roadways, pool area and extensive landscaped areas. For budgeting purposes, unless otherwise indicated, we have used June 1995 as the average placed-in-service date for aging the original components in this community.  
ARS site visits: March 1, 2014; January 2011; February 2009; April 2006; March 2005; March 2003; March 2002; April 2001 and March 2000

**Adequacy of Reserves as of June 1, 2014:**

Anticipated Reserve Balance	\$860,450.00
Fully Funded Reserve Balance	\$1,011,228.83
Percent Funded	85.08%

**Recommended Funding for the 2014-2015 Fiscal Year:**

	Annual	Monthly	Per Unit Per Month
Member Contribution	\$110,659	\$9,221.58	\$55.22
Interest Contribution	\$5,977	\$498.09	\$2.98
Total Contribution	\$116,636	\$9,719.66	\$58.20

3.18.2014(1) 1 ADVANCED RESERVE SOLUTIONS, INC.

#### **Adequacy of Reserves**

Displays the results of calculations with regard to the “health” of the reserve fund as of the beginning of the fiscal year for which the reserve analysis was prepared. Provides the anticipated reserve balance, fully funded reserve balance and the percent funded.

# Preface

## Calculation of Percent Funded

Summary displays all reserve components, shown here in “category” order. Provides the remaining life, useful life, current cost and the fully funded balance at the beginning of the fiscal year for which the reserve analysis was prepared.

### Reserve Components

All components are displayed (shown here in “category” order).

### Lifespans

Remaining life and useful life are displayed. And, these columns are conveniently sub totaled to show range.

**Sample Homeowners Association  
Calculation of Percent Funded  
Sorted by Category**

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
<b>010 Streets</b>				
Streets - Asphalt, Overlay / Major Rehab	8	27	\$101,867.50	\$71,564.91
Streets - Asphalt, Repair	0	4	\$3,621.75	\$3,621.75
Streets - Asphalt, Seal Coat	0	4	\$5,926.50	\$5,926.50
Streets - Concrete, Unfunded	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>0-8</b>	<b>4-27</b>	<b>\$111,245.75</b>	<b>\$81,113.16</b>
<b>020 Roads</b>				
Roads - Tile				
<b>Sub Total</b>				
<b>030 Painting</b>				
Painting - Cabana Interior				
Painting - Red Curbs				
Painting - Stucco				
Painting - Woodwork & Trim				
Painting - Wrought Iron, Buildings				
Painting - Wrought Iron, Pool Area				
<b>Sub Total</b>				
<b>040 Fencing</b>				
Fencing - Wrought Iron, Pool Area				
Railing - Wrought Iron, Buildings				
<b>Sub Total</b>				
<b>050 Lighting</b>				
Lighting - Buildings				
Lighting - Grounds				
<b>Sub Total</b>				
<b>060 Pool Area</b>				
Cabana - Ceramic Tile				
Cabana - Doors				
Cabana - Plumbing Fixtures				
Cabana - Restroom Partitions				
Cabana - Water Heater				
Pool - Filter				
Pool - Heater				
Pool - Replaster & Tile Replace				
Pool Area - Barbecues				
<b>Sub Total</b>				

**Sample Homeowners Association  
Calculation of Percent Funded  
Sorted by Category**

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
Pool Area - Ceramic Tile	2	21	\$8,501.63	\$7,773.38
Pool Area - Concrete Deck, Unfunded	n.a.	n.a.	\$0.00	\$0.00
Pool Area - Furniture (Refurbish)	0	12	\$9,255.00	\$9,255.00
Pool Area - Furniture (Replace)	6	25	\$17,315.00	\$13,159.40
Pool Area - Mastic	0	4	\$5,131.50	\$5,131.50
Spa - Filter	0	13	\$1,350.00	\$1,350.00
Spa - Heater	0	10	\$3,050.00	\$3,050.00
Spa - Replaster & Tile Replace	3	8	\$5,250.00	\$3,126.40
<b>Sub Total</b>	<b>0-6</b>	<b>4-25</b>	<b>\$91,747.38</b>	<b>\$71,964.53</b>
<b>070 Decks</b>				
Decks - Clean & Top Coat	2	5	\$30,480.00	\$18,288.00
Decks - Resurface	2	13	\$65,227.20	\$54,720.81
<b>Sub Total</b>	<b>2</b>	<b>5-13</b>	<b>\$95,707.20</b>	<b>\$73,008.81</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	2	21	\$27,625.00	\$24,994.05
Utility Closet Doors	2	21	\$73,900.00	\$60,801.90
<b>Sub Total</b>	<b>2</b>	<b>21</b>	<b>\$101,525.00</b>	<b>\$91,855.95</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	0	12	\$20,000.00	\$20,000.00
Landscape - Renovation, Unfunded	n.a.	n.a.	\$0.00	\$0.00
Mailboxes	2	21	\$37,200.00	\$33,657.14
<b>Sub Total</b>	<b>0-2</b>	<b>12-21</b>	<b>\$66,200.00</b>	<b>\$62,657.14</b>
<b>100 Termite Control</b>				
Termite Control	n.a.	n.a.	\$0.00	\$100,000.00
<b>Sub Total</b>	<b>n.a.</b>	<b>n.a.</b>	<b>\$0.00</b>	<b>\$100,000.00</b>
Contingency	n.a.	n.a.	n.a.	\$20,453.27
<b>Total</b>	<b>0-11</b>	<b>2-30</b>	<b>\$1,091,533.70</b>	<b>\$1,011,228.83</b>
<b>Anticipated Reserve Balance</b>				<b>\$865,456.00</b>
<b>Percent Funded</b>				<b>85.58%</b>

### Current Cost

Displays the current cost to replace or otherwise maintain each component. This column is conveniently sub totaled.

### Fully Funded Balance

Displays the fully funded balance for each component. This column is conveniently sub totaled.

The total current cost to replace or otherwise maintain all components, total fully funded balance, anticipated reserve balance and percent funded are provided at the bottom of this summary. Also shown is the range of reserve component remaining lives and useful lives.



# Preface

## Management / Accounting Summary and Charts

Summary displays all reserve components, shown here in “category” order. Provides the assigned reserve funds at the beginning of the fiscal year for which the reserve analysis was prepared along with the monthly member contribution, interest contribution and total contribution for each component and category. Pie charts show graphically how the total reserve fund is distributed amongst the reserve component categories and how each category is funded on a monthly basis.

**Balance at FYB**  
Shows the amount of reserve funds assigned to each reserve component. And, this column is conveniently sub totaled.


**Sample Homeowners Association**  
Management / Accounting Summary  
Component Calculation Method; Sorted by Category

	Balance at Fiscal Year Beginning	Monthly Member Contribution	Monthly Interest Contribution	Total Monthly Contribution
<b>010 Streets</b>				
Streets - Asphalt, Overlay / Major Rehab	\$17,837.90	\$949.09	\$13.37	\$963.07
Streets - Asphalt, Repair	\$3,821.75	\$78.20	\$0.25	\$78.45
Streets - Asphalt, Seal Coat	\$5,928.50	\$127.96	\$0.41	\$128.37
Streets - Concrete, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$27,586.15</b>	<b>\$1,155.84</b>	<b>\$14.04</b>	<b>\$1,169.88</b>
<b>020 Roofs</b>				
Roofs - Tile				
<b>Sub Total</b>				
<b>030 Painting</b>				
Painting - Cabana Interior				
Painting - Red Curbs				
Painting - Stucco				
Painting - Woodwork & Trim				
Painting - Wrought Iron, Buildings				
Painting - Wrought Iron, Pool Area				
<b>Sub Total</b>				
<b>040 Fencing</b>				
Fencing - Wrought Iron, Pool Area				
Railing - Wrought Iron, Buildings				
<b>Sub Total</b>				
<b>050 Lighting</b>				
Lighting - Buildings				
Lighting - Grounds				
<b>Sub Total</b>				
<b>060 Pool Area</b>				
Cabana - Ceramic Tile				
Cabana - Doors				
Cabana - Plumbing Fixtures				
Cabana - Restroom Partitions				
Cabana - Water Heater				
Pool - Filter				
<b>Sub Total</b>				
<b>070 Decks</b>				
Decks - Clean & Top Coat	\$18,288.00	\$539.52	\$12.44	\$551.96
Decks - Resurfacing	\$94,720.81	\$906.93	\$33.65	\$940.58
<b>Sub Total</b>	<b>\$73,008.81</b>	<b>\$1,046.45</b>	<b>\$46.09</b>	<b>\$1,092.54</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	\$24,994.05	\$139.11	\$15.07	\$154.19
Utility Closet Doors	\$95,881.90	\$372.15	\$40.32	\$412.47
<b>Sub Total</b>	<b>\$91,855.95</b>	<b>\$511.26</b>	<b>\$55.40</b>	<b>\$566.66</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	\$20,000.00	\$219.48	\$0.71	\$220.19
Landscape - Renovation, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Mailboxes	\$33,657.14	\$187.33	\$20.30	\$207.63
<b>Sub Total</b>	<b>\$62,657.14</b>	<b>\$406.82</b>	<b>\$21.00</b>	<b>\$427.82</b>
<b>100 Termite Control</b>				
Termite Control	\$100,000.00	\$0.00	\$58.52	\$58.52
<b>Sub Total</b>	<b>\$100,000.00</b>	<b>\$0.00</b>	<b>\$58.52</b>	<b>\$58.52</b>
Contingency	\$25,207.28	\$268.59	\$15.61	\$284.20
<b>Total</b>	<b>\$865,450.00</b>	<b>\$9,221.58</b>	<b>\$498.09</b>	<b>\$9,719.66</b>

**Monthly Funding**  
Displays the monthly funding for each component from the members and interest. Total monthly funding is also indicated. And, these columns are conveniently sub totaled.

**Sample Homeowners Association**  
Management / Accounting Summary  
Component Calculation Method; Sorted by Category

	Balance at Fiscal Year Beginning	Monthly Member Contribution	Monthly Interest Contribution	Total Monthly Contribution
Pool - Heater	\$3,250.00	\$24.60	\$0.08	\$24.68
Pool - Replaster & Tile Replace	\$7,070.58	\$146.76	\$4.61	\$151.37
Pool Area - Barbecues	\$1,010.00	\$26.98	\$0.69	\$30.67
Pool Area - Ceramic Tile	\$7,773.38	\$43.27	\$4.69	\$47.96
Pool Area - Concrete Deck, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Pool Area - Furniture (Refurbish)	\$9,255.00	\$70.05	\$0.23	\$70.27
Pool Area - Furniture (Replace)	\$13,159.40	\$74.78	\$7.94	\$82.70
Pool Area - Mastic	\$5,131.50	\$110.79	\$0.36	\$111.15
Spa - Filter	\$1,350.00	\$12.11	\$0.04	\$12.15
Spa - Heater	\$2,200.00	\$27.36	\$0.09	\$27.44
Spa - Replaster & Tile Replace	\$3,128.40	\$54.12	\$2.04	\$56.15
<b>Sub Total</b>	<b>\$71,964.53</b>	<b>\$716.19</b>	<b>\$30.10</b>	<b>\$746.28</b>
<b>070 Decks</b>				
Decks - Clean & Top Coat	\$18,288.00	\$539.52	\$12.44	\$551.96
Decks - Resurfacing	\$94,720.81	\$906.93	\$33.65	\$940.58
<b>Sub Total</b>	<b>\$73,008.81</b>	<b>\$1,046.45</b>	<b>\$46.09</b>	<b>\$1,092.54</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	\$24,994.05	\$139.11	\$15.07	\$154.19
Utility Closet Doors	\$95,881.90	\$372.15	\$40.32	\$412.47
<b>Sub Total</b>	<b>\$91,855.95</b>	<b>\$511.26</b>	<b>\$55.40</b>	<b>\$566.66</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	\$20,000.00	\$219.48	\$0.71	\$220.19
Landscape - Renovation, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Mailboxes	\$33,657.14	\$187.33	\$20.30	\$207.63
<b>Sub Total</b>	<b>\$62,657.14</b>	<b>\$406.82</b>	<b>\$21.00</b>	<b>\$427.82</b>
<b>100 Termite Control</b>				
Termite Control	\$100,000.00	\$0.00	\$58.52	\$58.52
<b>Sub Total</b>	<b>\$100,000.00</b>	<b>\$0.00</b>	<b>\$58.52</b>	<b>\$58.52</b>
Contingency	\$25,207.28	\$268.59	\$15.61	\$284.20
<b>Total</b>	<b>\$865,450.00</b>	<b>\$9,221.58</b>	<b>\$498.09</b>	<b>\$9,719.66</b>

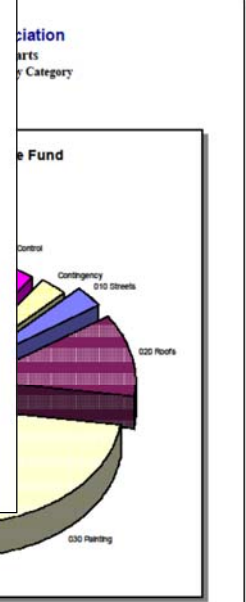

**Pie Charts**  
Show graphically how the reserve fund is distributed amongst the reserve components and how the components are funded.

# Preface

## Projections and Charts

Summary displays projections of beginning reserve balance, member contribution, interest contribution, expenditures and ending reserve balance for each year of the projection period (shown here for 30 years). The two columns on the right-hand side provide the fully funded ending balance and the percent funded for each year. Charts show the same information in an easy-to-understand graphic format.

**Sample Homeowners Association  
Projections  
Component Calculation Method**




Fiscal Year	Beginning Balance	Member Contribution	Interest Contribution	Expenditures	Ending Balance	Fully Funded Ending Balance	Percent Funded
2014-2015	\$865,450	\$110,659	\$5,977	\$54,980	\$917,106	\$1,046,139	88%
2015-2016	\$917,106	\$111,857	\$6,482	\$45,317	\$990,127	\$1,104,098	90%
2016-2017	\$990,127	\$116,806	\$3,175	\$591,549	\$518,559	\$598,939	87%
2017-2018	\$518,559	\$115,807	\$3,900	\$7,715	\$630,610	\$698,915	90%
2018-2019	\$630,610	\$116,508	\$4,431	\$52,973	\$698,577	\$755,512	92%
2019-2020	\$698,577	\$116,723	\$5,037	\$34,701	\$785,578	\$834,243	94%
2020-2021	\$785,578	\$118,645	\$5,331	\$80,731	\$828,821	\$896,179	92%
2021-2022	\$828,821	\$121,028	\$5,925	\$40,530	\$915,241	\$949,147	96%
2022-2023	\$915,241	\$123,506					
2023-2024	\$907,080	\$125,898					
2024-2025	\$1,037,322	\$126,436					
2025-2026	\$825,894	\$127,755					
2026-2027	\$780,089	\$125,648					
2027-2028	\$713,358	\$119,373					
2028-2029	\$631,867	\$131,699					
2029-2030	\$696,194	\$131,038					
2030-2031	\$1,013,798	\$137,575					
2031-2032	\$1,130,018	\$141,510					
2032-2033	\$1,237,543	\$143,162					
2033-2034	\$973,366	\$138,561					
2034-2035	\$1,104,489	\$147,134					
2035-2036	\$1,222,996	\$149,242					
2036-2037	\$1,317,743	\$150,808					
2037-2038	\$929,828	\$142,178					
2038-2039	\$1,078,992	\$157,813					
2039-2040	\$1,102,377	\$157,111					
2040-2041	\$1,234,862	\$165,390					
2041-2042	\$952,363	\$161,588					
2042-2043	\$1,056,301	\$171,747					
2043-2044	\$1,200,105	\$169,299					

NOTE: In some cases, the projected Ending Balance Expenditures. This is a result of the provision of contingency is continually adjusted according to

3.18.2014(1)

Improved format makes the numbers as easy to read and understand as possible. The color-coded bar indicates the reserve fund status:

Green: Good  
Yellow: Fair  
Red: Poor

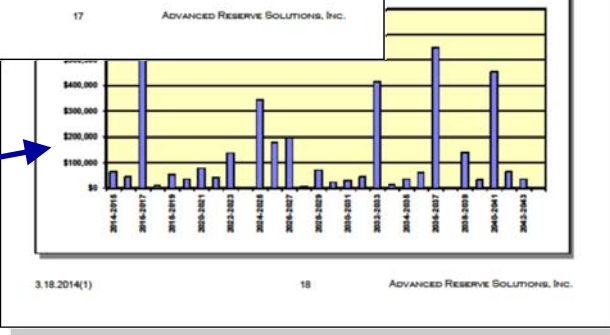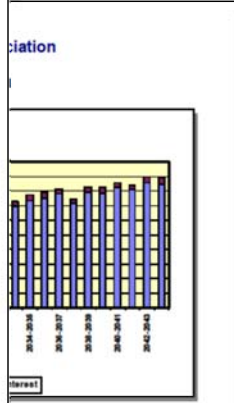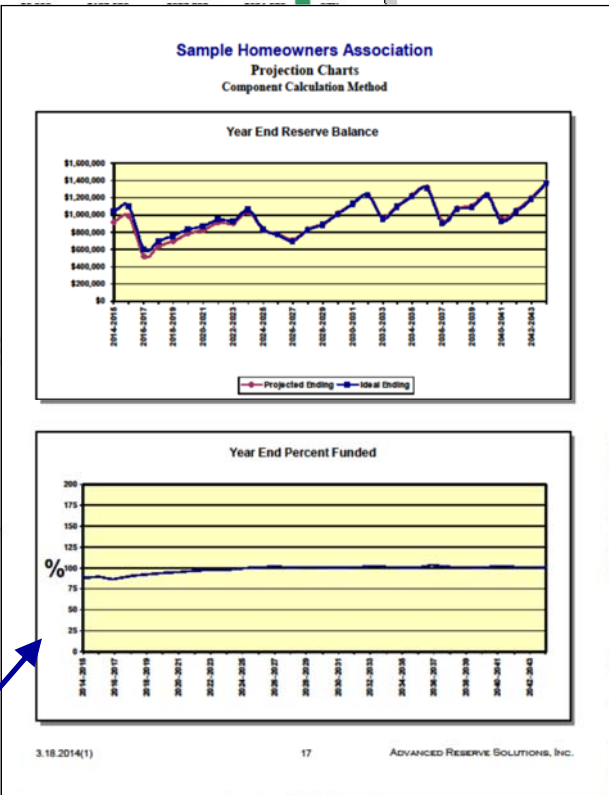

**Charts**  
Show graphically the reserve funding plan through time.

# Preface

## Component Detail

Summary provides detailed information about each reserve component. These pages display all information about each reserve component as well as comments from site observations and historical information regarding replacement or other maintenance.

### Lifespan Information

Displays placed-in-service date, useful life, remaining life and replacement year.

### Cost Information

Displays quantity, unit cost, percentage of replacement, current cost and future cost.

### Calculation Results

Displays assigned reserves and funding requirements.

**Streets - Asphalt, Seal Coat**

Category	010 Streets	Quantity	65,850 sq. ft.
Photo Date	January 2011	Unit Cost	\$0.090
		% of Replacement	100.00%
		Current Cost	\$5,926.50
		Future Cost	\$6,415.03
Placed In Service	11/09	Assigned Reserves at FYB	\$5,926.50
Useful Life	4	Monthly Member Contribution	\$127.96
Remaining Life	0	Monthly Interest Contribution	\$0.41
Replacement Year	2014-2015	Total Monthly Contribution	\$128.37

**Painting - Woodwork & Trim**

Category	030 Painting	Quantity	31,575 sq. ft.
Photo Date	January 2011	Unit Cost	\$0.620
		% of Replacement	100.00%
		Current Cost	\$20,949.00
		Future Cost	\$30,222.58
Placed In Service	06/12	Assigned Reserves at FYB	\$14,524.50
Useful Life	4	Monthly Member Contribution	\$634.91
Remaining Life	2	Monthly Interest Contribution	\$10.54
Replacement Year	2016-2017	Total Monthly Contribution	\$645.45

**Pool - Replaster & Tile Replace**

Category	060 Pool Area	Quantity	1 pool
Photo Date	January 2011	Unit Cost	\$15,075.000
		% of Replacement	100.00%
		Current Cost	\$15,075.00
		Future Cost	\$16,644.02
Placed In Service	01/10	Assigned Reserves at FYB	\$7,070.58
Useful Life	10	Monthly Member Contribution	\$146.79
Remaining Life	5	Monthly Interest Contribution	\$4.61
Replacement Year	2019-2020	Total Monthly Contribution	\$151.37

**Comments**

The association seal coated and restriped the streets for a total cost of \$5,926.50. The association repaired, seal coated and restriped the streets for a total cost of \$6,415.03. The association seal coated and restriped the streets for a total cost of \$6,415.03. The current cost used for this component is adjusted for inflation where applicable. Asphalt surfaces should be seal coated on...

The association painted the woodwork and trim for a total cost of \$20,949.00. The association painted the woodwork and trim for a total cost of \$30,222.58. The current cost used for this component is adjusted for inflation where applicable. For budgeting purposes, we have used the component. The inventory for this component has been March 2000 site visit, we believe this inventory is accurate.

The pool and spa were replastered in March 2000 for a total cost of approximately \$6,700. The association washed the pool in June 2002 for a total cost of \$675. The association replastered the pool and spa (including replacement of the mastic directly adjacent to the pool and spa) in January 2010 for a total cost of \$15,000.

### Comments

Useful information from site observations and historical expenses included here.

### Photos

Optional inclusion of photos adds an additional layer of detail to the reserve analysis.

## Preface

### ◆ ◆ ◆ ◆ GLOSSARY OF KEY TERMS ◆ ◆ ◆ ◆

#### **Annual Contribution Increase Parameter**

The rate used in the calculation of the funding plan. This rate is used on an annual compounding basis. This rate represents, in theory, the rate the association expects to increase contributions each year.

In most cases, this rate should match the inflation parameter. Matching the annual contribution increase parameter to the inflation parameter indicates, in theory, that member contributions should increase at the same rate as the cost of living (inflation parameter). Due to the “time value of money,” this creates the most equitable distribution of member contributions through time.

This parameter is used to develop a funding plan only; it does not mean that the reserve contributions must be raised each year. There are far more significant factors that will contribute to a total reserve contribution increase or decrease from year to year than this parameter. See the description of “reserve funding calculation methods” in this preface for more detail on this parameter.

#### **Anticipated Reserve Balance (or Reserve Funds)**

The amount of money, as of a certain point in time, held by the association to be used for the repair or replacement of reserve components. This figure is “anticipated” because it is calculated based on the most current financial information available as of the analysis date, which is almost always prior to the fiscal year beginning date for which the reserve analysis is prepared.

#### **Assigned Funds (and “Fixed” Assigned Funds)**

The amount of money, as of the fiscal year beginning date for which the reserve analysis is prepared, that a reserve component has been assigned.

The assigned funds are considered “fixed” when the normal calculation process is bypassed and a specific amount of money is assigned to a reserve component. For example, if the normal calculation process assigns \$10,000 to the roofs, but the association would like to show \$20,000 assigned to roofs, “fixed” funds of \$20,000 can be assigned.

#### **Cash Flow Calculation Method**

Reserve funding calculation method developed based on total annual expenditures. A more detailed description of the actual calculation process is included in the “reserve funding calculation methods” section of the preface.

#### **Component Calculation Method**

Reserve funding calculation method developed based on each individual component. A more detailed description of the actual calculation process is included in the “reserve funding calculation methods” section of the preface.

#### **Contingency Parameter**

The rate used as a built-in buffer in the calculation of the funding plan. This rate will assign a percentage of the reserve funds, as of the fiscal year beginning, as contingency funds and will also determine the level of funding toward the contingency each month.

#### **Current Replacement Cost**

The amount of money, as of the fiscal year beginning date for which the reserve analysis is prepared, that a reserve component is expected to cost to replace.

#### **Fiscal Year**

Indicates the budget year for the association for which the reserve analysis was prepared. The fiscal year beginning (FYB) is the first day of the budget year; the fiscal year end (FYE) is the last day of the budget year.

#### **Fully Funded Reserve Balance (or Ideal Reserves)**

The amount of money that should theoretically have accumulated in the reserve fund as of a certain point in time. Fully funded reserves are calculated for each reserve component based on the current replacement cost, age and useful life:

## Preface

$$\text{Fully Funded Reserves} = \frac{\text{Age}}{\text{Useful Life}} \times \text{Current Replacement Cost}$$

The fully funded reserve balance is the sum of the fully funded reserves for each reserve component.

An association that has accumulated the fully funded reserve balance does not have all of the funds necessary to replace all of its reserve components immediately; it has the proportionately appropriate reserve funds for the reserve components it maintains, based on each component's current replacement cost, age and useful life.

### **Future Replacement Cost**

The amount of money, as of the fiscal year during which replacement of a reserve component is scheduled, that a reserve component is expected to cost to replace. This cost is calculated using the current replacement cost compounded annually by the inflation parameter.

### **Global Parameters**

The financial parameters used to calculate the reserve analysis. See also "inflation parameter," "annual contribution increase parameter," "investment rate parameter" and "taxes on investments parameter."

### **Inflation Parameter**

The rate used in the calculation of future costs for reserve components. This rate is used on an annual compounding basis. This rate represents the rate the association expects the cost of goods and services relating to their reserve components to increase each year.

### **Interest Contribution**

The amount of money contributed to the reserve fund by the interest earned on the reserve fund and member contributions.

### **Investment Rate Parameter**

The gross rate used in the calculation of interest contribution (interest earned) from the reserve balance and member contributions. This rate (net of the taxes on investments parameter) is used on a monthly compounding basis. This parameter represents the weighted average interest rate the association expects to earn on their reserve fund investments.

### **Membership Contribution**

The amount of money contributed to the reserve fund by the association's membership.

### **Monthly Contribution (and "Fixed" Monthly Contribution)**

The amount of money, for the fiscal year which the reserve analysis is prepared, that a reserve component will be funded.

The monthly contribution is considered "fixed" when the normal calculation process is bypassed and a specific amount of money is funded to a reserve component. For example, if the normal calculation process funds \$1,000 to the roofs each month, but the association would like to show \$500 funded to roofs each month, a "fixed" contribution of \$500 can be assigned.

### **Number of Units (or other assessment basis)**

Indicates the number of units for which the reserve analysis was prepared. In "phased" developments (see phasing), this number represents the number of units, and corresponding common area components, that existed as of a certain point in time.

For some associations, assessments and reserve contributions are based on a unit of measure other than the number of units. Examples include time-interval weeks for timeshare resorts or lot acreage for commercial/industrial developments.

## Preface

### **One-Time Replacement**

Used for components that will be budgeted for only once.

### **Percent Funded**

A measure, expressed as a percentage, of the association's reserve fund "health" as of a certain point in time. This number is the ratio of the anticipated reserve fund balance to the fully funded reserve balance:

$$\text{Percent Funded} = \frac{\text{Anticipated Reserve Fund Balance}}{\text{Fully Funded Reserve Balance}}$$

An association that is 100% funded does not have all of the reserve funds necessary to replace all of its reserve components immediately; it has the proportionately appropriate reserve funds for the reserve components it maintains, based on each component's current replacement cost, age and useful life.

### **Percentage of Replacement**

The percentage of the reserve component that is expected to be replaced.

For most reserve components, this percentage should be 100%. In some cases, this percentage may be more or less than 100%. For example, fencing which is shared with a neighboring community may be set at 50%.

### **Phasing**

Indicates the number of phases for which the reserve analysis was prepared and the total number of phases expected at build-out (i.e. Phase 4 of 7). In phased developments, the first number represents the number of phases, and corresponding common area components, that existed as of a certain point in time. The second number represents the number of phases that are expected to exist at build-out.

### **Placed-In-Service Date**

The date (month and year) that the reserve component was originally put into service or last replaced.

### **Remaining Life**

The length of time, in years, until a reserve component is scheduled to be replaced.

### **Remaining Life Adjustment**

The length of time, in years, that a reserve component is expected to last in excess (or deficiency) of its useful life for the current cycle of replacement.

If the current cycle of replacement for a reserve component is expected to be greater than or less than the "normal" life expectancy, the reserve component's life should be adjusted using a remaining life adjustment.

For example, if wood trim is painted normally on a 4 year cycle, the useful life should be 4 years. However, when it comes time to paint the wood trim and it is determined that it can be deferred for an additional year, the useful life should remain at 4 years and a remaining life adjustment of +1 year should be used.

### **Replacement Year**

The fiscal year that a reserve component is scheduled to be replaced.

### **Reserve Components**

Line items included in the reserve analysis.

### **Taxes on Investments Parameter**

The rate used to offset the investment rate parameter in the calculation of the interest contribution. This parameter represents the marginal tax rate the association expects to pay on interest earned by the reserve funds and member contributions.

# Preface

## **Total Contribution**

The sum of the membership contribution and interest contribution.

## **Useful Life**

The length of time, in years, that a reserve component is expected to last each time it is replaced. See also “remaining life adjustment.”

## ◆ ◆ ◆ ◆ **LIMITATIONS OF RESERVE ANALYSIS** ◆ ◆ ◆ ◆

This reserve analysis is intended as a tool for the association’s Board of Directors to be used in evaluating the association’s current physical and financial condition with regard to reserve components. The results of this reserve analysis represent the independent opinion of the preparer. There is no implied warranty or guarantee of this work product.

For the purposes of this reserve analysis, it has been assumed that all components have been installed properly, no construction defects exist and all components are operational. Additionally, it has been assumed that all components will be maintained properly in the future.

The representations set forth in this reserve analysis are based on the best information and estimates of the preparer as of the date of this analysis. These estimates are subject to change. This reserve analysis includes estimates of replacement costs and life expectancies as well as assumptions regarding future events. Some estimates are projections of future events based on information currently available and are not necessarily indicative of the actual future outcome. The longer the time period between the estimate and the estimated event, the more likely the possibility of error and/or discrepancy. For example, some assumptions inevitably will not materialize and unanticipated events and circumstances may occur subsequent to the preparation of this reserve analysis. Therefore, the actual replacement costs and remaining lives may vary from this reserve analysis and the variation may be significant. Additionally, inflation and other economic events may impact this reserve analysis, particularly over an extended period of time and those events could have a significant and negative impact on the accuracy of this reserve analysis and, further, the funds available to meet the association’s obligation for repair, replacement or other maintenance of major components during their estimated useful life. Furthermore, the occurrence of vandalism, severe weather conditions, earthquakes, floods, acts of nature or other unforeseen events cannot be predicted and/or accounted for and are excluded when assessing life expectancy, repair and/or replacement costs of the components.

# Boulder Creek Neighborhoods - Pinnacle

## Executive Summary

### Directed Cash Flow Calculation Method

**Client Information:**

Account Number	80352
Version Number	2
Analysis Date	11/11/2019
Fiscal Year	1/1/2020 to 12/31/2020
Number of Units	44
Phasing	1 of 1

**Global Parameters:**

Inflation Rate	2.00 %
Annual Contribution Increase	2.00 %
Investment Rate	1.00 %
Taxes on Investments	30.00 %
Contingency	2.00 %

**Community Profile:**

Pinnacle Homeowners Association, Inc. is a 44 unit association comprised of 22 buildings with common areas that include but are not limited to; roofs, exterior paint, decks and common area landscaping.

This community was built in 2016. For budgeting purposes, unless otherwise indicated, we have used January 2016 as the average placed in service date for aging the original components included in this analysis.

ARS, Inc. field inspection conducted at Boulder Creek Neighborhood office: February 27, 2014. This is a level III reserve analysis. There was NO on-site inspection conducted during the preparation of this analysis.

**Adequacy of Reserves as of January 1, 2020:**

Anticipated Reserve Balance	<b>\$125,000.00</b>
Fully Funded Reserve Balance	<b>\$241,380.94</b>
Percent Funded	<b>51.79%</b>

<b>Recommended Funding for the 2020 Fiscal Year:</b>	<b>Annual</b>	<b>Monthly</b>	<b>Per Unit Per Month</b>
Member Contribution	<b>\$65,000</b>	<b>\$5,416.67</b>	<b>\$123.11</b>
Interest Contribution	<b>\$1,087</b>	<b>\$90.56</b>	<b>\$2.06</b>
Total Contribution	<b>\$66,087</b>	<b>\$5,507.23</b>	<b>\$125.16</b>



# **Boulder Creek Neighborhoods - Pinnacle**

## **Preparer's Disclosure Statement**

THIS RESERVE ANALYSIS REFLECTS THE COMPONENTS AS THEY WERE INTENDED TO HAVE BEEN DESIGNED AND CONSTRUCTED. THIS ANALYSIS DOES NOT INCLUDE ANY EXPENDITURES ANTICIPATED FOR REPAIRS REQUIRED DUE TO DEFECTIVE CONDITIONS.

In April 2011, Richard Hirschman was awarded the Reserve Specialist (RS) designation from Community Associations Institute (CAI). Mr. Hirschman was the two hundredth twenty first (#221) person in the United States to receive this professional designation.

The RS designation was developed by CAI for professional reserve analysts who wish to confirm to their peers and/or clients that they have demonstrated a basic level of competency within the industry. The RS designation is awarded to reserve analysts who are dedicated to the highest standards of professionalism and reserve analysis preparation.

Consultant certifies that:

- 1) Consultant has no other involvement with association which could result in actual or perceived conflicts of interest.
- 2) Consultant made office visit to discuss particulars of community on February 27, 2014. Component inventories were developed by actual field inventory, representative sampling, take-offs of scaled plans, provided by the association's previous reserve analysis prepared by another firm or provided by the association.
- 3) Financial conditional assessments were developed by actual field observation and representative sampling.
- 3) Financial assumptions used in this analysis are listed on the Executive Summary and further explained in the Preface of this report.
- 4) Consultant is a Reserve Specialist (RS) designee.
- 5) This analysis is an update of a previous reserve analysis prepared by our firm. The original analysis was prepared using development plans and drawing as well as information from the builder, it is still dependent in many respects on the validity of the original reserve analysis.
- 6) There are no material issues known to consultant at this time which would cause a distortion of the association's situation.

## Boulder Creek Neighborhoods - Pinnacle

### Calculation of Percent Funded

Sorted by Category

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
<b><u>010 Roofs</u></b>				
Roofs - Composition Shingle, Phase 1	21	25	\$191,994.00	\$30,719.04
Roofs - Composition Shingle, Phase 2	22	26	\$191,994.00	\$29,537.54
Roofs - Composition Shingle, Phase 3	23	27	\$191,994.00	\$28,443.56
<b>Sub Total</b>	<b>21-23</b>	<b>25-27</b>	<b>\$575,982.00</b>	<b>\$88,700.13</b>
<b><u>020 Siding</u></b>				
Siding - Building Exterior, Cemplank, Phase 1	46	50	\$267,300.00	\$21,384.00
Siding - Building Exterior, Cemplank, Phase 2	47	51	\$267,300.00	\$20,964.71
Siding - Building Exterior, Cemplank, Phase 3	48	52	\$267,300.00	\$20,561.54
Siding - Building Exterior, Shingle	26	30	\$87,600.00	\$11,680.00
Siding - Building Exterior, Stone (Unfunded)	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>26-48</b>	<b>30-52</b>	<b>\$889,500.00</b>	<b>\$74,590.24</b>
<b><u>030 Painting</u></b>				
Painting - Building Exterior, Cemplank	6	10	\$112,500.00	\$45,000.00
Painting - Building Exterior, Shingle	6	10	\$18,250.00	\$7,300.00
<b>Sub Total</b>	<b>6</b>	<b>10</b>	<b>\$130,750.00</b>	<b>\$52,300.00</b>
<b><u>040 Lighting</u></b>				
Lighting - Building Exterior	20	24	\$26,400.00	\$4,400.00
<b>Sub Total</b>	<b>20</b>	<b>24</b>	<b>\$26,400.00</b>	<b>\$4,400.00</b>
<b><u>050 Decks &amp; Railings</u></b>				
Decks & Railings - Building Exterior	36	40	\$111,376.00	\$11,137.60
<b>Sub Total</b>	<b>36</b>	<b>40</b>	<b>\$111,376.00</b>	<b>\$11,137.60</b>
<b><u>055 Mailboxes</u></b>				
Mailboxes - Pedestal Sets, Unfunded	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>n.a.</b>	<b>n.a.</b>	<b>\$0.00</b>	<b>\$0.00</b>
<b><u>060 Monument Structure</u></b>				
Monument Structure	44	50	\$4,600.00	\$552.00
<b>Sub Total</b>	<b>44</b>	<b>50</b>	<b>\$4,600.00</b>	<b>\$552.00</b>
<b><u>070 Irrigation Controller</u></b>				
Irrigation Controller, Unfunded	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>n.a.</b>	<b>n.a.</b>	<b>\$0.00</b>	<b>\$0.00</b>
<b><u>075 Backflow Devices</u></b>				
Backflow Devices - Unfunded	n.a.	n.a.	\$0.00	\$0.00

# Boulder Creek Neighborhoods - Pinnacle

## Calculation of Percent Funded

Sorted by Category

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
<b>Sub Total</b>	n.a.	n.a.	\$0.00	\$0.00
<b>090 Concrete</b>				
Concrete - Drives & Front Walks	6	10	\$12,420.00	\$4,968.00
<b>Sub Total</b>	<b>6</b>	<b>10</b>	<b>\$12,420.00</b>	<b>\$4,968.00</b>
Contingency	n.a.	n.a.	n.a.	\$4,732.96
<b>Total</b>	<b>6-48</b>	<b>10-52</b>	<b>\$1,751,028.00</b>	<b>\$241,380.94</b>
<b>Anticipated Reserve Balance</b>				<b>\$125,000.00</b>
<b>Percent Funded</b>				<b>51.79%</b>

**Boulder Creek Neighborhoods - Pinnacle**  
**Management / Accounting Summary**  
**Directed Cash Flow Calculation Method; Sorted by Category**

	<b>Balance at Fiscal Year Beginning</b>	<b>Monthly Member Contribution</b>	<b>Monthly Interest Contribution</b>	<b>Total Monthly Contribution</b>
<b><u>010 Roofs</u></b>				
Roofs - Composition Shingle, Phase 1	\$30,719.04	\$646.29	\$19.72	\$666.01
Roofs - Composition Shingle, Phase 2	\$29,537.54	\$625.07	\$18.98	\$644.05
Roofs - Composition Shingle, Phase 3	\$624.44	\$678.90	\$2.86	\$681.76
<b>Sub Total</b>	<b>\$60,881.02</b>	<b>\$1,950.26</b>	<b>\$41.56</b>	<b>\$1,991.82</b>
<b><u>020 Siding</u></b>				
Siding - Building Exterior, Cemplank, Phase 1	\$0.00	\$543.00	\$2.01	\$545.01
Siding - Building Exterior, Cemplank, Phase 2	\$0.00	\$534.52	\$1.98	\$536.50
Siding - Building Exterior, Cemplank, Phase 3	\$0.00	\$526.41	\$1.95	\$528.36
Siding - Building Exterior, Shingle	\$0.00	\$279.73	\$1.03	\$280.76
Siding - Building Exterior, Stone (Unfunded)	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$1,883.66</b>	<b>\$6.96</b>	<b>\$1,890.62</b>
<b><u>030 Painting</u></b>				
Painting - Building Exterior, Cemplank	\$45,000.00	\$866.05	\$28.59	\$894.65
Painting - Building Exterior, Shingle	\$7,300.00	\$140.49	\$4.64	\$145.13
<b>Sub Total</b>	<b>\$52,300.00</b>	<b>\$1,006.55</b>	<b>\$33.23</b>	<b>\$1,039.78</b>
<b><u>040 Lighting</u></b>				
Lighting - Building Exterior	\$4,400.00	\$92.03	\$2.83	\$94.85
<b>Sub Total</b>	<b>\$4,400.00</b>	<b>\$92.03</b>	<b>\$2.83</b>	<b>\$94.85</b>
<b><u>050 Decks &amp; Railings</u></b>				
Decks & Railings - Building Exterior	\$0.00	\$272.69	\$1.00	\$273.69
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$272.69</b>	<b>\$1.00</b>	<b>\$273.69</b>
<b><u>055 Mailboxes</u></b>				
Mailboxes - Pedestal Sets, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>
<b><u>060 Monument Structure</u></b>				
Monument Structure	\$0.00	\$9.66	\$0.04	\$9.70
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$9.66</b>	<b>\$0.04</b>	<b>\$9.70</b>
<b><u>070 Irrigation Controller</u></b>				
Irrigation Controller, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>

# Boulder Creek Neighborhoods - Pinnacle


## Management / Accounting Summary

Directed Cash Flow Calculation Method; Sorted by Category

	<b>Balance at Fiscal Year Beginning</b>	<b>Monthly Member Contribution</b>	<b>Monthly Interest Contribution</b>	<b>Total Monthly Contribution</b>
<b><u>075 Backflow Devices</u></b>				
Backflow Devices - Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>	<b>\$0.00</b>
<b><u>090 Concrete</u></b>				
Concrete - Drives & Front Walks	\$4,968.00	\$95.61	\$3.15	\$98.77
<b>Sub Total</b>	<b>\$4,968.00</b>	<b>\$95.61</b>	<b>\$3.15</b>	<b>\$98.77</b>
Contingency	\$2,450.98	\$106.21	\$1.78	\$107.99
<b>Total</b>	<b>\$125,000.00</b>	<b>\$5,416.67</b>	<b>\$90.56</b>	<b>\$5,507.23</b>


**Boulder Creek Neighborhoods - Pinnacle**  
**Management / Accounting Charts**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Distribution of Current Reserve Fund**

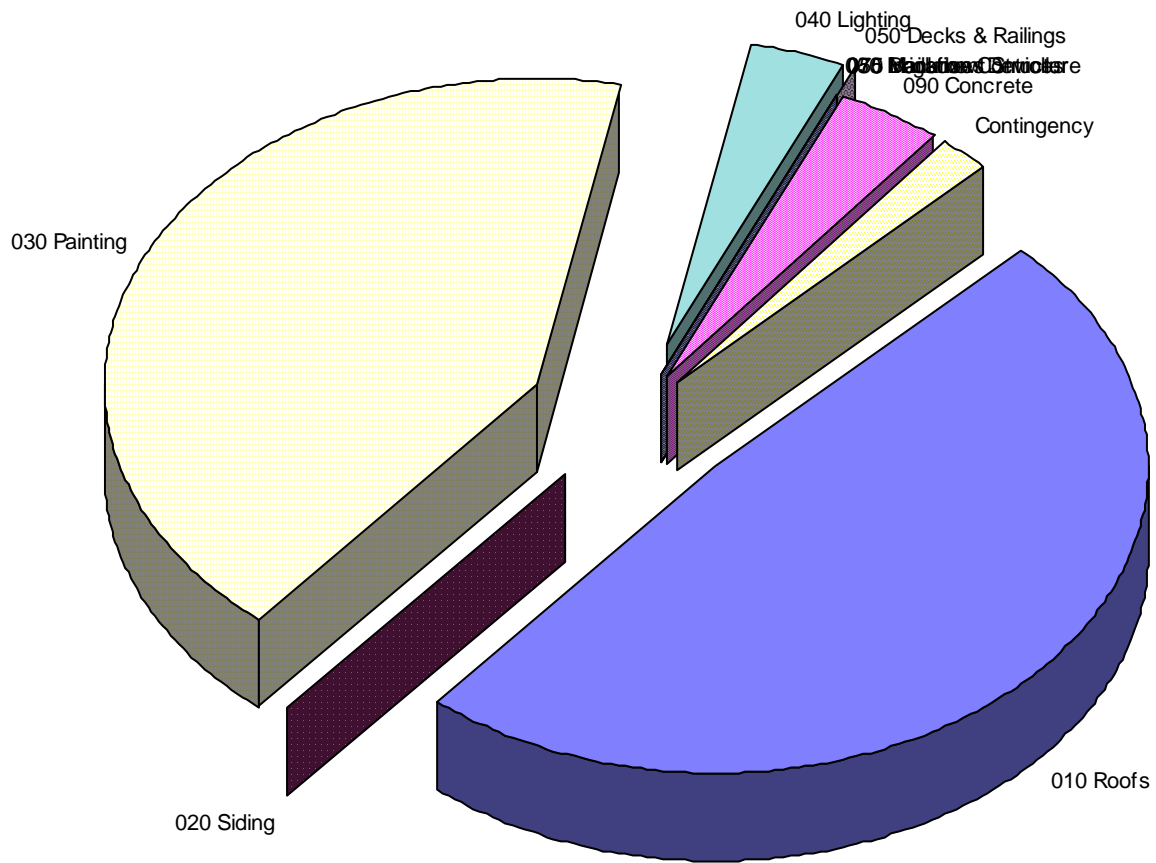

**Boulder Creek Neighborhoods - Pinnacle**  
**Management / Accounting Charts**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Monthly Member Contribution**

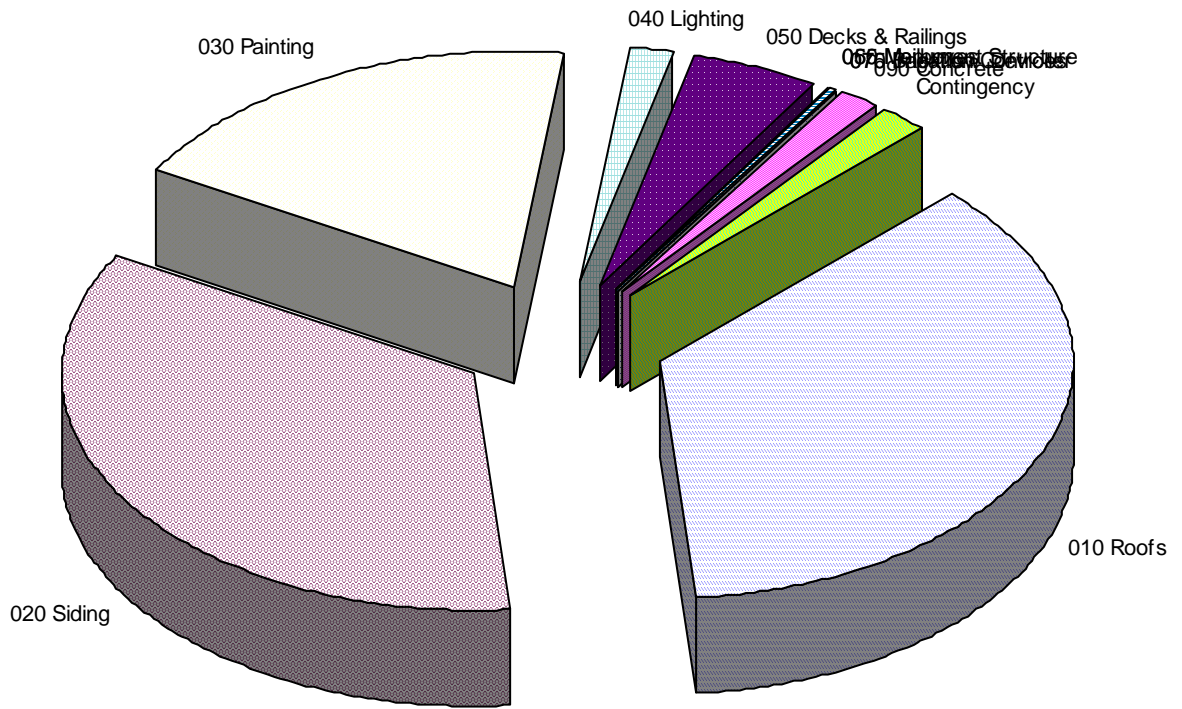

# Boulder Creek Neighborhoods - Pinnacle

## Annual Expenditure Detail

Sorted by Description

### 2026 Fiscal Year

Concrete - Drives & Front Walks	\$13,986.94
Painting - Building Exterior, Cemplank	\$126,693.27
Painting - Building Exterior, Shingle	\$20,552.46

**Sub Total** \$161,232.67

### 2036 Fiscal Year

Concrete - Drives & Front Walks	\$17,050.00
Painting - Building Exterior, Cemplank	\$154,438.39
Painting - Building Exterior, Shingle	\$25,053.34

**Sub Total** \$196,541.73

### 2040 Fiscal Year

Lighting - Building Exterior	\$39,229.01
------------------------------	-------------

**Sub Total** \$39,229.01

### 2041 Fiscal Year

Roofs - Composition Shingle, Phase 1	\$290,998.84
--------------------------------------	--------------

**Sub Total** \$290,998.84

### 2042 Fiscal Year

Roofs - Composition Shingle, Phase 2	\$296,818.82
--------------------------------------	--------------

**Sub Total** \$296,818.82

### 2043 Fiscal Year

Roofs - Composition Shingle, Phase 3	\$302,755.20
--------------------------------------	--------------

**Sub Total** \$302,755.20

### 2046 Fiscal Year

Concrete - Drives & Front Walks	\$20,783.85
Painting - Building Exterior, Cemplank	\$188,259.54
Painting - Building Exterior, Shingle	\$30,539.88
Siding - Building Exterior, Shingle	\$146,591.43

**Sub Total** \$386,174.70



# Boulder Creek Neighborhoods - Pinnacle

## Projections

### Directed Cash Flow Calculation Method



Fiscal Year	Beginning Balance	Member Contribution	Interest Contribution	Expenditures	Ending Balance	Fully Funded Ending Balance	Percent Funded
2020	\$125,000	\$65,000	\$1,087	\$0	\$191,087	\$307,713	62%
2021	\$191,087	\$66,300	\$1,555	\$0	\$258,942	\$376,601	69%
2022	\$258,942	\$67,626	\$2,036	\$0	\$328,604	\$448,123	73%
2023	\$328,604	\$68,979	\$2,529	\$0	\$400,111	\$522,354	77%
2024	\$400,111	\$70,358	\$3,036	\$0	\$473,506	\$599,375	79%
2025	\$473,506	\$71,765	\$3,556	\$0	\$548,827	\$679,268	81%
2026	\$548,827	\$73,201	\$2,957	\$161,233	\$463,752	\$594,371	78%
2027	\$463,752	\$74,665	\$3,497	\$0	\$541,913	\$676,908	80%
2028	\$541,913	\$76,158	\$4,050	\$0	\$622,121	\$762,508	82%
2029	\$622,121	\$77,681	\$4,619	\$0	\$704,421	\$851,261	83%
2030	\$704,421	\$79,235	\$5,202	\$0	\$788,857	\$943,260	84%
2031	\$788,857	\$80,819	\$5,800	\$0	\$875,476	\$1,038,598	84%
2032	\$875,476	\$82,436	\$6,413	\$0	\$964,325	\$1,137,372	85%
2033	\$964,325	\$84,084	\$7,042	\$0	\$1,055,451	\$1,239,682	85%
2034	\$1,055,451	\$85,766	\$7,688	\$0	\$1,148,905	\$1,345,629	85%
2035	\$1,148,905	\$87,481	\$8,349	\$0	\$1,244,736	\$1,455,318	86%
2036	\$1,244,736	\$89,231	\$7,648	\$196,542	\$1,145,073	\$1,364,375	84%
2037	\$1,145,073	\$91,016	\$8,334	\$0	\$1,244,423	\$1,477,783	84%
2038	\$1,244,423	\$92,836	\$9,037	\$0	\$1,346,296	\$1,595,182	84%
2039	\$1,346,296	\$94,693	\$9,759	\$0	\$1,450,747	\$1,716,686	85%
2040	\$1,450,747	\$96,587	\$10,223	\$39,229	\$1,518,328	\$1,801,598	84%
2041	\$1,518,328	\$98,518	\$8,936	\$290,999	\$1,334,783	\$1,628,095	82%
2042	\$1,334,783	\$100,489	\$7,612	\$296,819	\$1,146,065	\$1,447,406	79%
2043	\$1,146,065	\$102,498	\$6,252	\$302,755	\$952,060	\$1,259,771	76%
2044	\$952,060	\$104,548	\$7,022	\$0	\$1,063,630	\$1,385,339	77%
2045	\$1,063,630	\$106,639	\$7,812	\$0	\$1,178,082	\$1,515,425	78%
2046	\$1,178,082	\$108,772	\$5,911	\$386,175	\$906,590	\$1,248,384	73%
2047	\$906,590	\$110,948	\$6,723	\$0	\$1,024,261	\$1,379,868	74%
2048	\$1,024,261	\$113,167	\$7,557	\$0	\$1,144,984	\$1,516,111	76%
2049	\$1,144,984	\$115,430	\$8,412	\$0	\$1,268,826	\$1,657,252	77%

NOTE: In some cases, the projected Ending Balance may exceed the Fully Funded Ending Balance in years following high Expenditures. This is a result of the provision for contingency in this analysis, which in these projections is never expended. The contingency is continually adjusted according to need and any excess is redistributed among all components included.

# Boulder Creek Neighborhoods - Pinnacle

## Projection Charts



### Directed Cash Flow Calculation Method

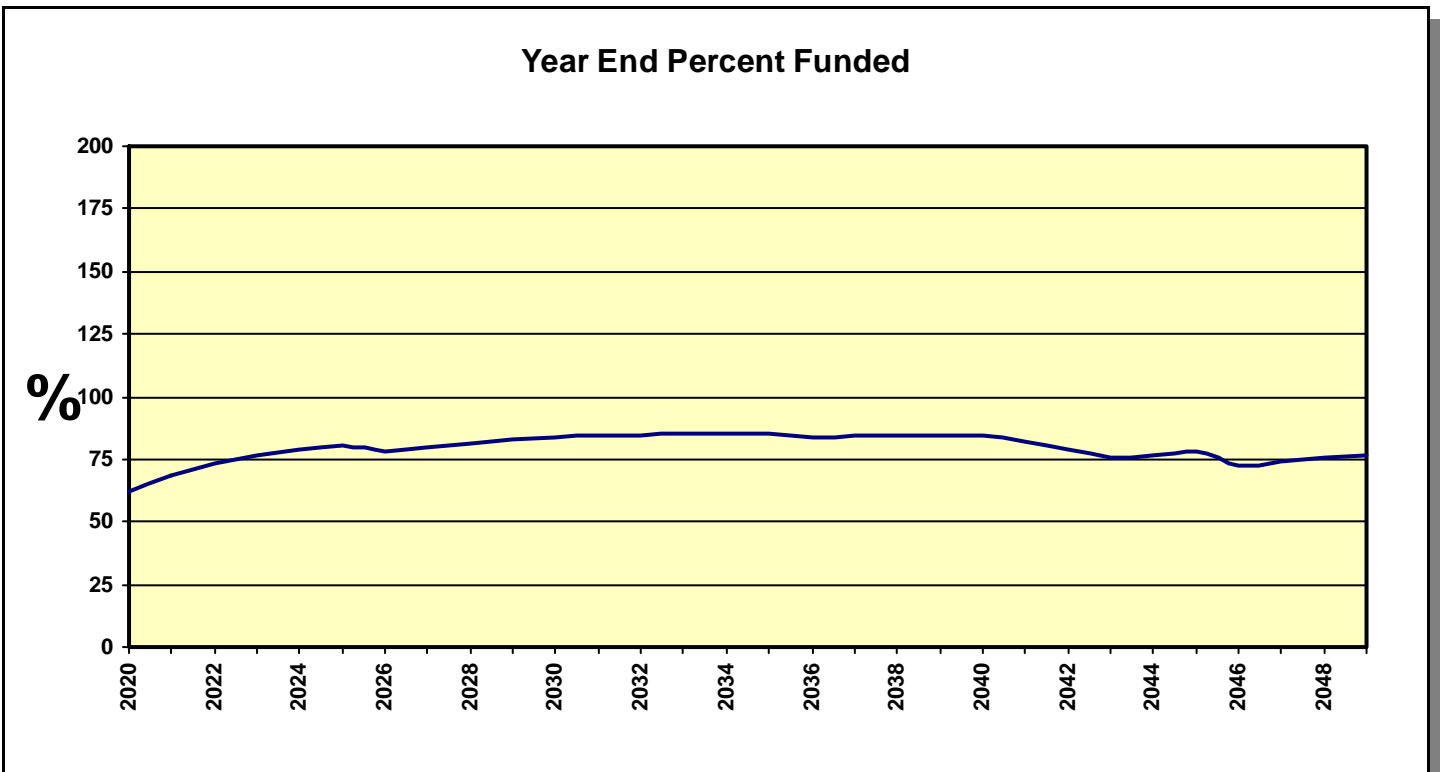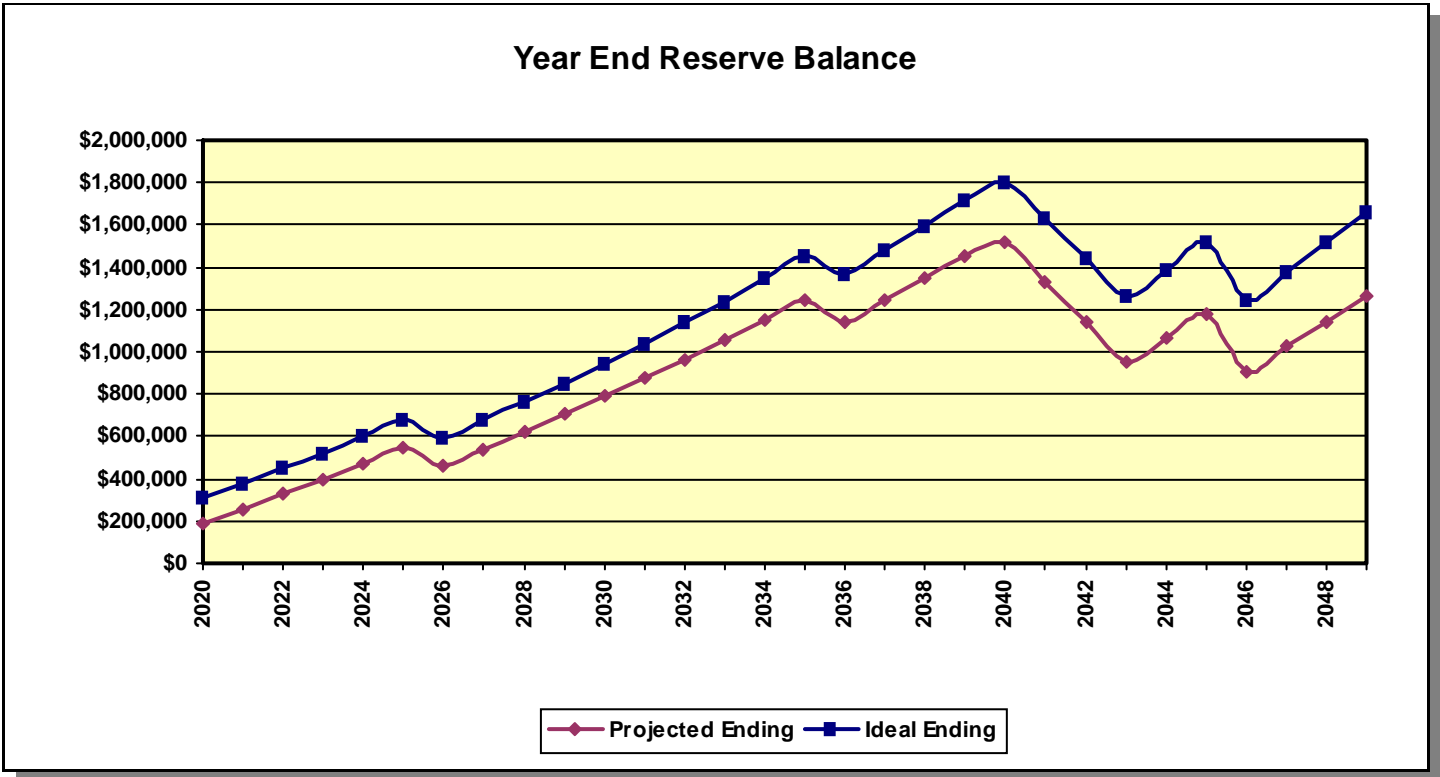

# Boulder Creek Neighborhoods - Pinnacle

## Projection Charts

### Directed Cash Flow Calculation Method

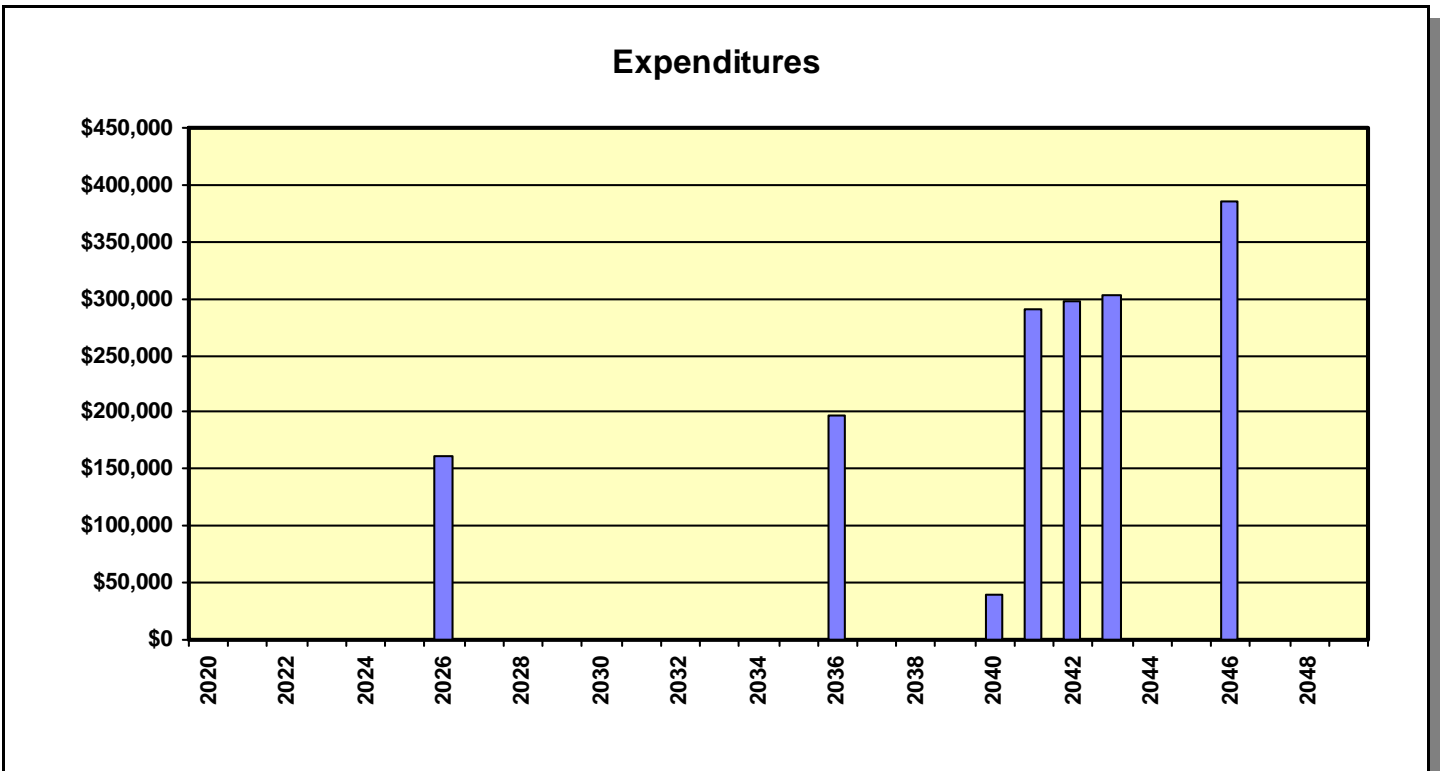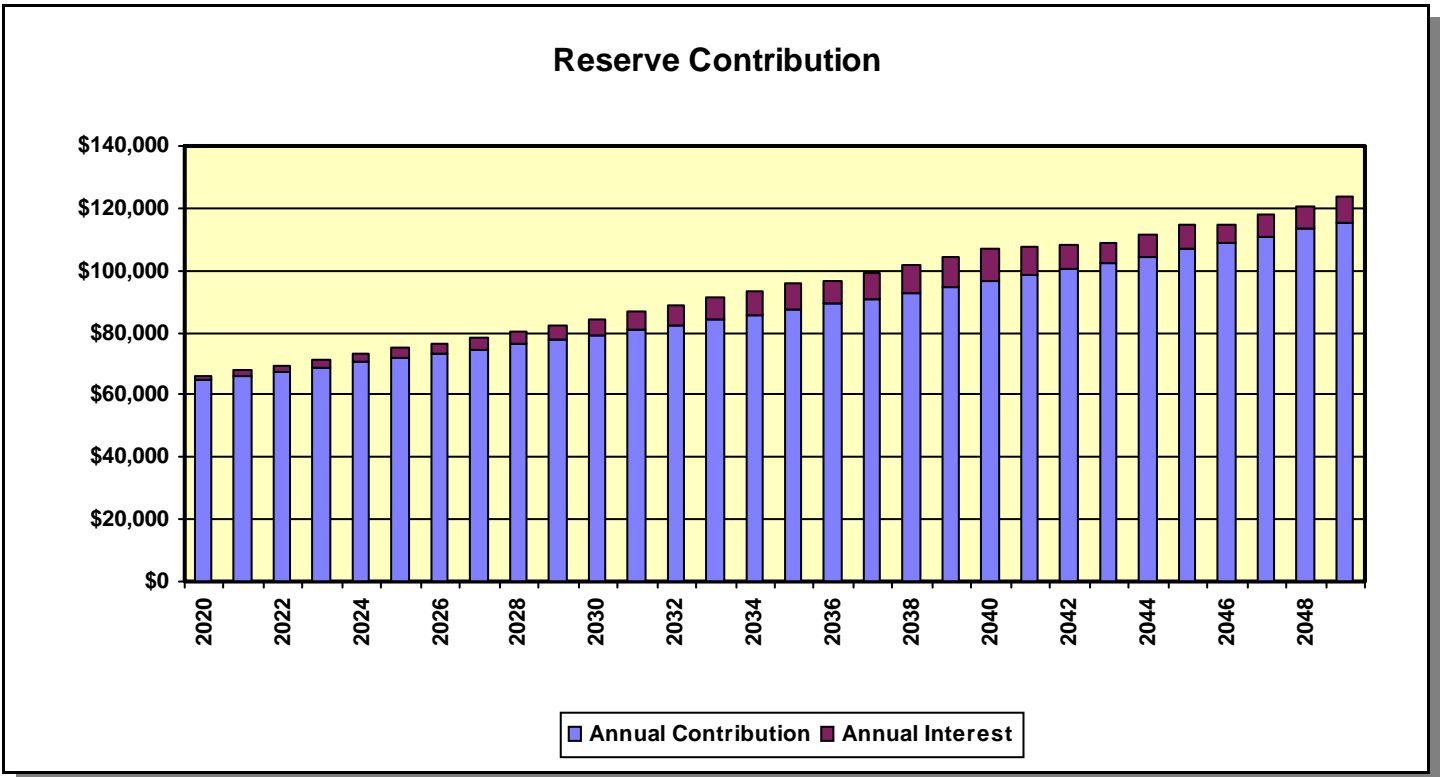

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Roofs - Composition Shingle, Phase 1

Category	010 Roofs	Quantity	1 total
		Unit Cost	\$581,800.00
		% of Replacement	33.00%
		Current Cost	\$191,994.00
Placed In Service	01/16	Future Cost	\$290,998.84
Useful Life	25		
		Assigned Reserves at FYB	\$30,719.04
Remaining Life	21	Monthly Member Contribution	\$646.29
Replacement Year	2041	Monthly Interest Contribution	\$19.72
		Total Monthly Contribution	\$666.01

Comments:

According to the client, these are class 4 impact resistant asphalt shingle roofs located on the buildings. It is anticipated that the client will replace 33% of the roofs in phase 1.

In order to ensure a high quality installation, the client may wish to obtain the services of an independent roofing consultant to work with the client and the roofing contractor providing installation. Consultants are available for the preparation of installation specifications and, if desired, to work with the contractor during the installation process. Fees for these services vary based on the size of the project and detail required by the client, and have not been included in the cost used for this component. Should the client desire, a provision for a consultant can be incorporated into this analysis.

32,400 sq. ft. - plan 710	@	\$5.00	=	\$162,000.00
29,000 sq. ft. - plan 730-1	@	\$5.00	=	\$145,000.00
27,000 sq. ft. - plan 730-2	@	\$5.00	=	\$135,000.00
27,960 sq. ft. - plan 740	@	\$5.00	=	\$139,800.00
		<b>TOTAL</b>	<b>=</b>	<b><u>\$581,800.00</u></b>

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Roofs - Composition Shingle, Phase 2

Category	010 Roofs	Quantity	1 total
		Unit Cost	\$581,800.00
		% of Replacement	33.00%
		Current Cost	\$191,994.00
		Future Cost	\$296,818.82
Placed In Service	01/16		
Useful Life	25		
Adjustment	+1	Assigned Reserves at FYB	\$29,537.54
Remaining Life	22	Monthly Member Contribution	\$625.07
Replacement Year	2042	Monthly Interest Contribution	\$18.98
		Total Monthly Contribution	\$644.05

Comments:

According to the client, these are class 4 impact resistant asphalt shingle roofs located on the buildings. It is anticipated that the client will replace 33% of the roofs in phase 2.

In order to ensure a high quality installation, the client may wish to obtain the services of an independent roofing consultant to work with the client and the roofing contractor providing installation. Consultants are available for the preparation of installation specifications and, if desired, to work with the contractor during the installation process. Fees for these services vary based on the size of the project and detail required by the client, and have not been included in the cost used for this component. Should the client desire, a provision for a consultant can be incorporated into this analysis.

32,400 sq. ft. - plan 710	@	\$5.00	=	\$162,000.00
29,000 sq. ft. - plan 730-1	@	\$5.00	=	\$145,000.00
27,000 sq. ft. - plan 730-2	@	\$5.00	=	\$135,000.00
27,960 sq. ft. - plan 740	@	\$5.00	=	\$139,800.00
		<b>TOTAL</b>	<b>=</b>	<b><u>\$581,800.00</u></b>

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Roofs - Composition Shingle, Phase 3

Category	010 Roofs	Quantity	1 total
		Unit Cost	\$581,800.00
		% of Replacement	33.00%
		Current Cost	\$191,994.00
		Future Cost	\$302,755.20
Placed In Service	01/16		
Useful Life	25		
Adjustment	+2	Assigned Reserves at FYB	\$624.44
Remaining Life	23	Monthly Member Contribution	\$678.90
Replacement Year	2043	Monthly Interest Contribution	\$2.86
		Total Monthly Contribution	\$681.76

Comments:

According to the client, these are class 4 impact resistant asphalt shingle roofs located on the buildings. It is anticipated that the client will replace 33% of the roofs in phase 3.

In order to ensure a high quality installation, the client may wish to obtain the services of an independent roofing consultant to work with the client and the roofing contractor providing installation. Consultants are available for the preparation of installation specifications and, if desired, to work with the contractor during the installation process. Fees for these services vary based on the size of the project and detail required by the client, and have not been included in the cost used for this component. Should the client desire, a provision for a consultant can be incorporated into this analysis.

32,400 sq. ft. - plan 710	@	\$5.00	=	\$162,000.00
29,000 sq. ft. - plan 730-1	@	\$5.00	=	\$145,000.00
27,000 sq. ft. - plan 730-2	@	\$5.00	=	\$135,000.00
27,960 sq. ft. - plan 740	@	\$5.00	=	\$139,800.00
		<b>TOTAL</b>	<b>=</b>	<b><u>\$581,800.00</u></b>

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Siding - Building Exterior, Cemplank, Phase 1

Category	020 Siding	Quantity	90,000 sq. ft.
		Unit Cost	\$9.000
		% of Replacement	33.00%
		Current Cost	\$267,300.00
Placed In Service	01/16	Future Cost	\$664,671.20
Useful Life	50		
		Assigned Reserves at FYB	\$0.00
Remaining Life	46	Monthly Member Contribution	\$543.00
Replacement Year	2066	Monthly Interest Contribution	\$2.01
		Total Monthly Contribution	\$545.01

Comments:

This is for the replacement of the Cemplank siding on the buildings within the community. It is anticipated that the client will replace 33% of the siding in phase 1.

The inventory for this component has been provided by the client. Ongoing maintenance of the Cemplank siding will be handled by the client on an ongoing basis during the painting cycle.

### Siding - Building Exterior, Cemplank, Phase 2

Category	020 Siding	Quantity	90,000 sq. ft.
		Unit Cost	\$9.000
		% of Replacement	33.00%
		Current Cost	\$267,300.00
Placed In Service	01/16	Future Cost	\$677,964.62
Useful Life	50		
Adjustment	+1	Assigned Reserves at FYB	\$0.00
Remaining Life	47	Monthly Member Contribution	\$534.52
Replacement Year	2067	Monthly Interest Contribution	\$1.98
		Total Monthly Contribution	\$536.50

Comments:

This is for the replacement of the Cemplank siding on the buildings within the community. It is anticipated that the client will replace 33% of the siding in phase 2.

The inventory for this component has been provided by the client. Ongoing maintenance of the Cemplank siding will be handled by the client on an ongoing basis during the painting cycle.

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Siding - Building Exterior, Cemplank, Phase 3

Category	020 Siding	Quantity	90,000 sq. ft.
		Unit Cost	\$9.000
		% of Replacement	33.00%
		Current Cost	\$267,300.00
Placed In Service	01/16	Future Cost	\$691,523.91
Useful Life	50		
Adjustment	+2	Assigned Reserves at FYB	\$0.00
Remaining Life	48	Monthly Member Contribution	\$526.41
Replacement Year	2068	Monthly Interest Contribution	\$1.95
		Total Monthly Contribution	\$528.36

#### Comments:

This is for the replacement of the Cemplank siding on the buildings within the community. It is anticipated that the client will replace 33% of the siding in phase 3.

The inventory for this component has been provided by the client. Ongoing maintenance of the Cemplank siding will be handled by the client on an ongoing basis during the painting cycle.

### Siding - Building Exterior, Shingle

Category	020 Siding	Quantity	14,600 sq. ft.
		Unit Cost	\$6.000
		% of Replacement	100.00%
		Current Cost	\$87,600.00
Placed In Service	01/16	Future Cost	\$146,591.43
Useful Life	30		
		Assigned Reserves at FYB	\$0.00
Remaining Life	26	Monthly Member Contribution	\$279.73
Replacement Year	2046	Monthly Interest Contribution	\$1.03
		Total Monthly Contribution	\$280.76

#### Comments:

This is for the replacement of the shingle siding on the buildings within the community.

The inventory for this component has been provided by the client. Ongoing maintenance of the shingle siding will be handled by the client on an ongoing basis during the painting cycle.



# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Siding - Building Exterior, Stone (Unfunded)

Category	020 Siding	Quantity	11,800 sq. ft.
		Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	01/16	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

#### Comments:

This is the stone siding on the buildings within the community. It is anticipated that not all of the stone siding will need replacement at one time. Therefore, budgeting for this component has been excluded as future maintenance should be completed by the client on an as needed basis. This component is listed for inventory purposes only.

The inventory for this component has been provided by the client.

### Painting - Building Exterior, Cemplank

Category	030 Painting	Quantity	90,000 sq. ft.
		Unit Cost	\$1.250
		% of Replacement	100.00%
		Current Cost	\$112,500.00
Placed In Service	01/16	Future Cost	\$126,693.27
Useful Life	10		
		Assigned Reserves at FYB	\$45,000.00
Remaining Life	6	Monthly Member Contribution	\$866.05
Replacement Year	2026	Monthly Interest Contribution	\$28.59
		Total Monthly Contribution	\$894.65

#### Comments:

This is the painting of the Cemplank siding on the buildings within the community. The useful life for this component has been provided by the client.

The inventory for this component has been provided by the client.

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Painting - Building Exterior, Shingle

Category	030 Painting	Quantity	14,600 sq. ft.
		Unit Cost	\$1.250
		% of Replacement	100.00%
		Current Cost	\$18,250.00
Placed In Service	01/16	Future Cost	\$20,552.46
Useful Life	10		
		Assigned Reserves at FYB	\$7,300.00
Remaining Life	6	Monthly Member Contribution	\$140.49
Replacement Year	2026	Monthly Interest Contribution	\$4.64
		Total Monthly Contribution	\$145.13

Comments:

This is the painting of the shingle siding on the buildings within the community. The useful life for this component has been provided by the client.

The inventory for this component has been provided by the client.

### Lighting - Building Exterior

Category	040 Lighting	Quantity	1 total
		Unit Cost	\$26,400.000
		% of Replacement	100.00%
		Current Cost	\$26,400.00
Placed In Service	01/16	Future Cost	\$39,229.01
Useful Life	24		
		Assigned Reserves at FYB	\$4,400.00
Remaining Life	20	Monthly Member Contribution	\$92.03
Replacement Year	2040	Monthly Interest Contribution	\$2.83
		Total Monthly Contribution	\$94.85

Comments:

This is for the replacement of the exterior lighting fixtures located around the buildings.

88 fixtures, garage	@	\$150.00	=	\$13,200.00
44 fixtures, front patios	@	\$150.00	=	\$6,600.00
44 fixtures, back decks	@	\$150.00	=	\$6,600.00
		<b>TOTAL</b>	<b>=</b>	<b>\$26,400.00</b>

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Decks & Railings - Building Exterior

Category	050 Decks & Railings	Quantity	1 total
		Unit Cost	\$111,376.00
		% of Replacement	100.00%
		Current Cost	\$111,376.00
Placed In Service	01/16	Future Cost	\$227,194.49
Useful Life	40		
		Assigned Reserves at FYB	\$0.00
Remaining Life	36	Monthly Member Contribution	\$272.69
Replacement Year	2056	Monthly Interest Contribution	\$1.00
		Total Monthly Contribution	\$273.69

Comments:

This is for the replacement of Trex Deck and Trex Railing located on the exterior areas of the buildings.

2,620 sq. ft. - decks	@	\$28.00	=	\$73,360.00
500 ln. ft. - deck railing	@	\$22.00	=	\$11,000.00
550 sq. ft. - stair decking	@	\$28.00	=	\$15,400.00
528 ln. ft. - stair railing	@	\$22.00	=	\$11,616.00
		<b>TOTAL</b>	<b>=</b>	<u>\$111,376.00</u>

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Mailboxes - Pedestal Sets, Unfunded

Category	055 Mailboxes	Quantity	3 total
		Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	01/16	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

Comments:

These are metal 16-unit pedestal mounted mailboxes located within the community.

The inventory for this component has been provided by the client.

According to the client, the maintenance and replacement of the mailboxes is the responsibility of the USPS.

### Monument Structure

Category	060 Monument Structure	Quantity	1 structure
		Unit Cost	\$4,600.00
		% of Replacement	100.00%
		Current Cost	\$4,600.00
Placed In Service	01/14	Future Cost	\$10,994.24
Useful Life	50		
		Assigned Reserves at FYB	\$0.00
Remaining Life	44	Monthly Member Contribution	\$9.66
Replacement Year	2064	Monthly Interest Contribution	\$0.04
		Total Monthly Contribution	\$9.70

Comments:

This is a concrete and stone monument structure located within the community.

The cost and useful life estimates for this component have been provided by the client.

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Irrigation Controller, Unfunded

Category	070 Irrigation Controller	Quantity	1 comment
		Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	01/16	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

Comments:

This is for the replacement of one irrigation controller located within the community.

The inventory for this component has been provided by the client.

The replacement of the irrigation controller will be handled under the landscape refurbishment component within this analysis.

### Backflow Devices - Unfunded

Category	075 Backflow Devices	Quantity	1 comment
		Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	01/16	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

Comments:

According to the client there is one backflow device located within the community.

These devices require an annual inspection and should be repaired "as needed," thus, we have not provided an allocation for the replacement of these units.

# Boulder Creek Neighborhoods - Pinnacle

## Component Detail

Directed Cashflow Calculation Method; Sorted by Category

### Concrete - Drives & Front Walks

Category	090 Concrete	Quantity	23,000 sq. ft.
		Unit Cost	\$9.000
		% of Replacement	6.00%
		Current Cost	\$12,420.00
Placed In Service	01/16	Future Cost	\$13,986.94
Useful Life	10		
		Assigned Reserves at FYB	\$4,968.00
Remaining Life	6	Monthly Member Contribution	\$95.61
Replacement Year	2026	Monthly Interest Contribution	\$3.15
		Total Monthly Contribution	\$98.77

#### Comments:

These are the concrete driveways and front walkways within the community.

It is anticipated that not all of the concrete will need replacement at one time. Therefore, we have budgeted for 6% of the concrete to be repaired or replaced every 12 years. This component should be monitored over time and the replacement percentage and useful life adjusted accordingly.

# Boulder Creek Neighborhoods - Pinnacle

## Detail Report Index

	<b>Page</b>
Backflow Devices - Unfunded	22
Concrete - Drives & Front Walks	23
Decks & Railings - Building Exterior	20
Irrigation Controller, Unfunded	22
Lighting - Building Exterior	19
Mailboxes - Pedestal Sets, Unfunded	21
Monument Structure	21
Painting - Building Exterior, Cemplank	18
Painting - Building Exterior, Shingle	19
Roofs - Composition Shingle, Phase 1	13
Roofs - Composition Shingle, Phase 2	14
Roofs - Composition Shingle, Phase 3	15
Siding - Building Exterior, Cemplank, Phase 1	16
Siding - Building Exterior, Cemplank, Phase 2	16
Siding - Building Exterior, Cemplank, Phase 3	17
Siding - Building Exterior, Shingle	17
Siding - Building Exterior, Stone (Unfunded)	18

Number of components included in this reserve analysis is 17.